GE TEY Bolt-On Circuit Breakers

Circuit Breaker Mounting Base, Cat. No. TEY3B

1. Base may be mounted vertically or horizontally.
2. Install base mount using dimensions shown in Figure 1.
3. Drill clearance holes, not to exceed recommended size for #10 machine screw. If self-tapping screws are required, use recommended drill size.
4. Install the breaker by positioning the breaker mounting clips (Figure 2) under the retaining projections (Figure 1) on the mounting base. Locate the breaker line side mounting screws in the tapped holes of the base terminal assembly. Tighten screws to 23–28 in–lbs of torque.

CAUTION: PLEASE OBSERVE BREAKER LABELS FOR PROPER VOLTAGE REQUIREMENTS

5. Torque the mounting base lug screws to the following values:
   #1/0–#3, 50 in–lbs
   #4–#6, 45 in–lbs
   #8, 40 in–lbs
   #10–#14, 35 in–lbs
6. **NOTE:**
   This base is suitable for mounting circuit breakers on standard one inch, pole-to-pole center dimensions.

These instructions do not purport to cover all details or variations in equipment nor to provide for every possible contingency to be met in connection with installation operation or maintenance. Should further information be desired or should particular problems arise which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the GE Company.

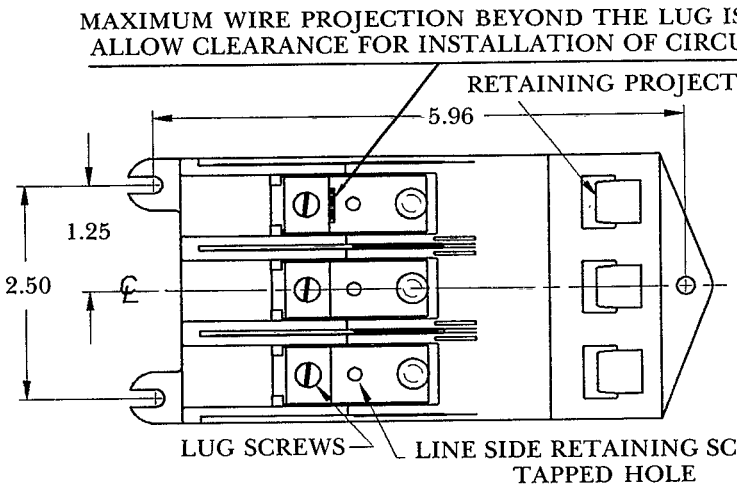


Figure 1

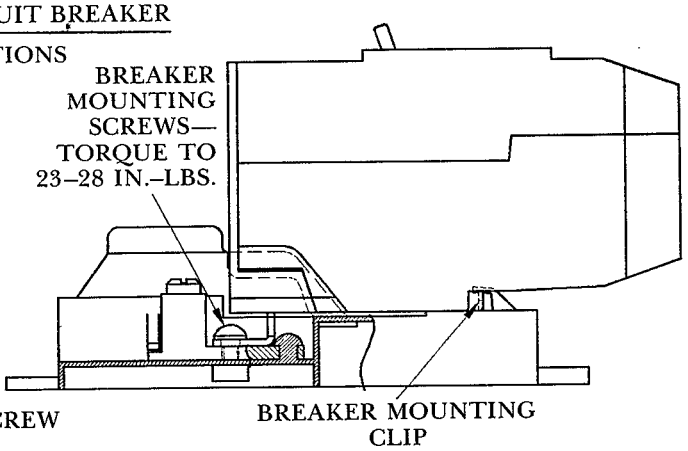


Figure 2

GE Electrical Distribution & Control

General Electric Company
41 Woodford Ave., Plainville, CT 06062

© 1988 General Electric Company